


Average Diameter Chart

Vertical	Horizontal	Average	Vertical	Horizontal	Average
3.2	3.0	3.1	3.8	3.0	3.4
3.2	3.2	3.2	3.8	3.2	3.5
3.2	3.4	3.3	3.8	3.4	3.6
3.2	3.6	3.4	3.8	3.6	3.7
3.2	3.8	3.5	3.8	3.8	3.8
3.2	4.0	3.6	3.8	4.0	3.9
3.2	4.2	3.7	3.8	4.2	4.0
3.2	4.4	3.8	3.8	4.4	4.1
3.2	4.6	3.9	3.8	4.6	4.2
Vertical	Horizontal	Average	Vertical	Horizontal	Average
3.4	3.0	3.2	4.0	3.0	3.5
3.4	3.2	3.3	4.0	3.2	3.6
3.4	3.4	3.4	4.0	3.4	3.7
3.4	3.6	3.5	4.0	3.6	3.8
3.4	3.8	3.6	4.0	3.8	3.9
3.4	4.0	3.7	4.0	4.0	4.0
3.4	4.2	3.8	4.0	4.2	4.1
3.4	4.4	3.9	4.0	4.4	4.2
3.4	4.6	4.0	4.0	4.6	4.3
Vertical	Horizontal	Average	Vertical	Horizontal	Average
3.6	3.0	3.3	4.2	3.0	3.6
3.6	3.2	3.4	4.2	3.2	3.7
3.6	3.4	3.5	4.2	3.4	3.8
3.6	3.6	3.6	4.2	3.6	3.9
3.6	3.8	3.7	4.2	3.8	4.0
3.6	4.0	3.8	4.2	4.0	4.1
3.6	4.2	3.9	4.2	4.2	4.2
3.6	4.4	4.0	4.2	4.4	4.3
3.6	4.6	4.1	4.2	4.6	4.4

Estimate the vertical diameter and the horizontal diameter.
Use chart to determine average the two.

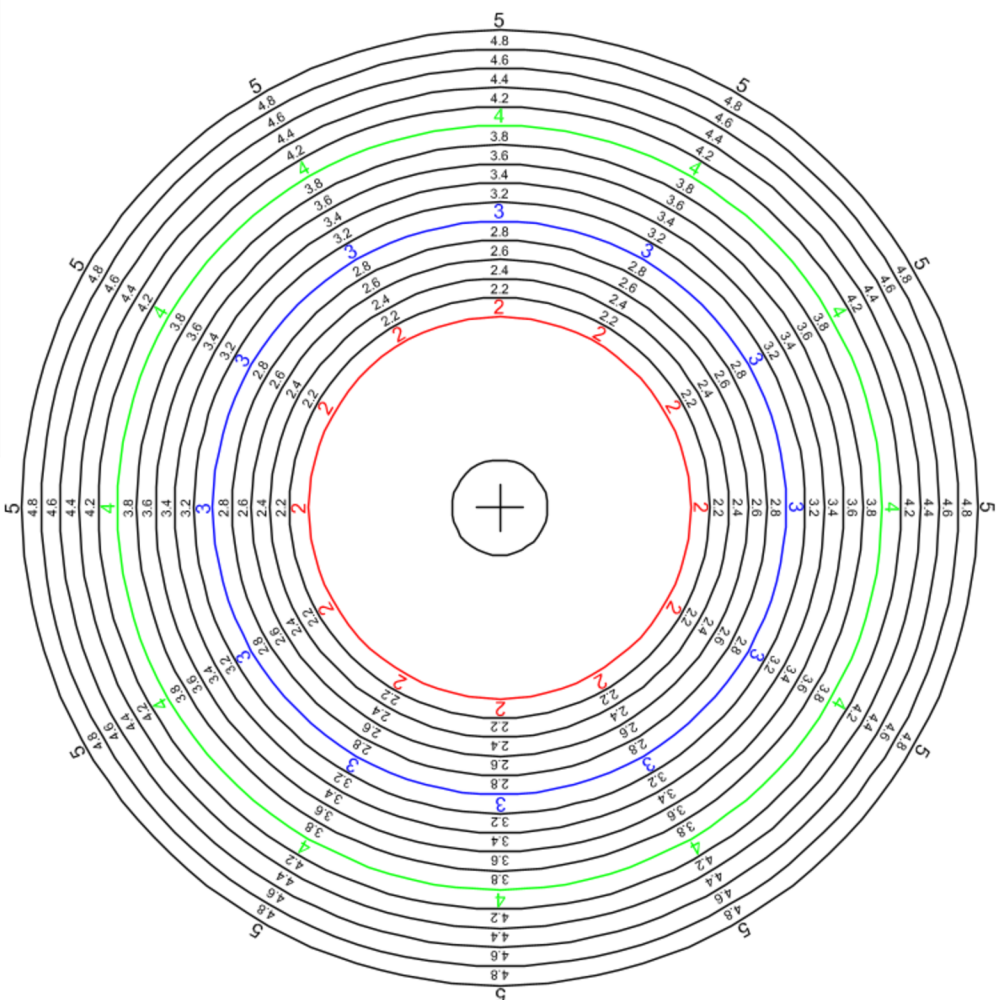

INSTRUCTIONS for VISCOSITY TARGET:

1. Draw approximately 50ml of 1DIP slurry into syringe.
2. Point tip upwards and tap any bubble(s) toward tip.
3. Push plunger to reduce volume of 1DIP to 30 ml.
4. Inject remaining bubble free slurry onto "+" of target *This should be done slowly trying to center slurry puddle in target zone, approximately 1-2" above the target.* Measure puddle diameter and average the readings all the way around the puddle.
5. Rinse sheet and syringe, repeat as needed.

PRINTED

03 APR. 18

CHRISTY MINERALS
SLURRY SCALE

ISSUED BY: S. REEVES
DATE: 5/26/16

ZONE	REV	DESCRIPTION	DATE	BY
-	D	Added Average Diameter Chart	4/2/16	JSR
-	C	Added Additional Numbering	9/2/16	JSR
-	B	Added Additional Numbering	9/2/16	JSR
-	A	ISSUE	5/26/16	JSR